Network Standard

NETWORK	Document No	: NW000-S0161
	Amendment No	: 4
	Approved By	: Head of AR&P
	Approval Date	: 6/10/2021

Minor amendments approved 21/10/2026

NW000-S0161 NS211 ANNEXURE G – LV HRC FUSE ASBESTOS PRODUCT GUIDE



Introduction

As part of Ausgrid's ongoing asbestos maintenance program, independent Licenced Asbestos Assessors have identified Low Voltage HRC fuses of various types as potentially asbestos containing.

Low voltage HRC fuses of various ratings are used throughout the distribution network and may be present in chamber substations, kiosk substation and other network locations.

The asbestos material is normally fully enclosed within the fuse body and asbestos fibres are not able to be released unless the fuse body is breached. The independent report indicates that "there is no elevated risk exposure to asbestos fibres from within fully intact undamaged HRC fuses".

SafeWork NSW exemption for the removal of LV HRC fuse removal by Ausgrid trained workers only

SafeWork NSW granted Ausgrid an exemption allowing for the removal of Low Voltage HRC fuses containing friable asbestos by trained workers under specific controlled conditions. The exemption is applicable for Ausgrid trained workers only and formalises the interim safe working arrangements previously communicated in the Safety Alerts released in December 2015 and March 2016.

A copy of the SafeWork exemption is included as the last 3 pages of this document. The requirements for managing compliance with the exemption order are listed in Schedule 1.

Product Guide

The aim of the guide is to assist staff to easily identify asbestos containing LV HRC Fuses and the Safety Instructions for dealing with them.

The following symbols were used within the Guide:

	Asbestos found in testing - exercise caution and follow safety instructions – do not reuse on the network
	No Asbestos found in testing, however exercise caution and follow safety instructions – do not reuse on the network
	No Asbestos found in testing to date – can be reused on the network

Note: All fuses listed in T0024 TS4200 Fuse Standard as current stock including Eaton, SIBA and Bussman brands are safe to use. Additionally, Fusemaster branded fuses (all amperages) can be reused. For all other fuses brands and amperages check the listing in this guide.

All Low Voltage HRC fuses of any rating, may contain friable asbestos material fully enclosed within the body of the fuse. There is no practical means to confirm if a fuse contains asbestos by visual identification unless it has been tested and is listed within this product guide.

The list of fuses within this document is not absolute, and as further testing is undertaken, results will be added.

Note: If a fuse type is not included within the Product Guide Follow Safety Precautions in accordance with NS211 - Working with Asbestos and ***dispose of the fuse as asbestos waste.***

For Ausgrid Workers*: Safety precautions must be implemented in accordance with NS211 - Working with Asbestos and dispose of the fuse as asbestos waste.

Fuse Handling Work

When conducting work to remove a low voltage HRC fuses, the worker should utilise Level 1 precautionary asbestos PPE (i.e. P2 respiratory protection and disposable nitrile gloves) in accordance with Ausgrid asbestos awareness training. Level 1 asbestos PPE must be worn as a precaution to undertake a visual inspection of the fuse to assess whether the fuse is a currently supplied fuse and the fuse condition.

If the fuse is able to be identified as non-asbestos containing in accordance with the above criteria, then work may proceed as normal.

If the fuse is unable to be identified as non-asbestos containing in accordance with the above criteria, then the fuse must be presumed to contain asbestos and safety precautions applied. Do not reinstall fuses that cannot be identified as asbestos free.

Safety Precautions

1. Safety Precautions must be implemented in accordance with NS211 - Working with Asbestos.
2. If the fuse body is damaged, isolated the area with asbestos warning tape and contact the Senior Project Officer - Hazmat to arrange removal.
3. If the fuse body is undamaged and intact the fuse may be carefully removed.
4. Once removed, the fuse tabs must not be bent.
5. Double bag as asbestos waste for disposed at an Ausgrid asbestos waste facility.
6. Personal decontamination. Level 1 PPE must be double bagged and disposed of as asbestos waste.

Fuse Disposal

- When disposing of LV HRC Fuses treat all fuses as asbestos waste.
- Care should be taken during disposal to prevent damage to the fuses which may rupture or break the fuse body.
- If a fuse body of an asbestos containing LV HRC fuse is damaged during disposal, isolated the area with asbestos warning tape and contact the Senior Project Officer - HazMat to arrange decontamination and removal.

***For ASP's and External contractors: When an asbestos containing LV HRC fuse is identified on the Ausgrid network that requires removal contact the relevant Project Officer / Manager to request rectification. Note: This does not apply to Service Protective Devices located at the customers installation. ASPs are responsible for removal and disposal in these instances.**

For further information or assistance contact

Hazardous Materials
02 9394 6961
hazmat@ausgrid.com.au

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
AEI	**400**	 54287-001-115	30600	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
AEI	**440**	 54287-001-103	440AC4F.F List 30655	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Alstom	**45**	 P033786.002-AS012	Alstom - AS2005 - 45Amp, SK45, 20kA/440V AC - 440V - no country - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Alstom	**60**	 OF00053-120718-AS05	RHF60, 60 AMP, 33kA, 415V AC, BS:1361-1971	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Alstom	**100**	 OF00053-120718-AS03	RHLF100, BS1361, 1971, 415V AC, ASTA (20) CERT, made in the UK	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Alstom	**100**	 OF00053-120718-AS14	RHLF100, 100AMP, 33kA, 415V AC, BS:1361-1971	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

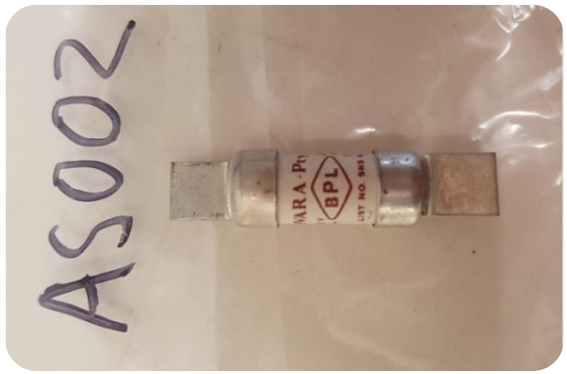
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Alstom Safeclip	**20**	 2101006/AS004	Details illegible, possibly 20 Amp)	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
ASEA		 P033768.003-AS020	XRD06, 500V~, 250V-, 60327	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Belling-Lee	**2**	 174783-001-AS046	L693 059-0110, 2A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

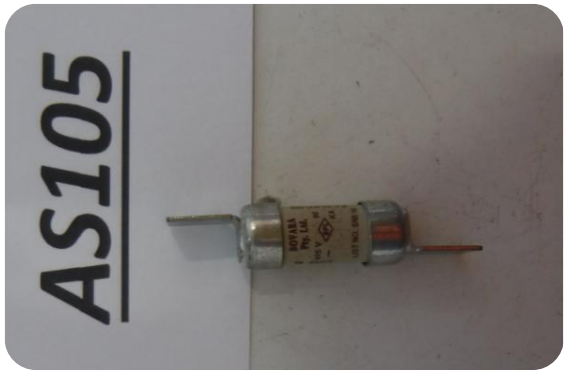
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Belling-Lee	**5**	 174783-001-AS047	L693 059-0112, 5A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**2**	 168273-106	SNS 2, 2A, 90AC, B.S-88, IEC 269	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**4**	 174783-001-AS052	SNS4, 4A, 80kA, BS88, IEC269	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bovara	**6**	 182621-001-002	SNS6, 6A, 90kA, BS-88 IEC269	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**10**	 174783-001-AS051	SNS10, 10A, 80kA, BS88 IEC269	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**10**	 174102-001-AS017	SNS10, 10A, BS88, IEC269, 80kA	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bovara	**16**	 168273-105	SNS 16, 16A, 90AC, B.S-88, IEC 269	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**20**	 168273-104	SNS 20, 20A, 90AC, B.S-88, IEC 269	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**32**	 54287-001-079	SNS 32	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bovara	**80**	 55738-001-006	AC80-6.5W, 80A, 80kA, 500V~,	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**80**	 OF00053-120718-AS09	ZR-2-80, AC 80 – 5.0W, 80A, 500 V~, IEC269-AS2005	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**100**	 54287-001-141	ZR-2-100	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bovara	**100**	 54287-002-031	AC80-6.0W, 100A, 80kA, 500V~, FF'R', 110430	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bovara	**400**	 174102-001-AS002	Tardofus AZ-2 glg, UNE-21.103, C.E.I. 269, 100kA, 199395	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bowthorpe Australia	**80**	 P033768.003 - AS003	TYPE ENAA, 80A, WFF, ACS CERTIFIED (label worn)	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

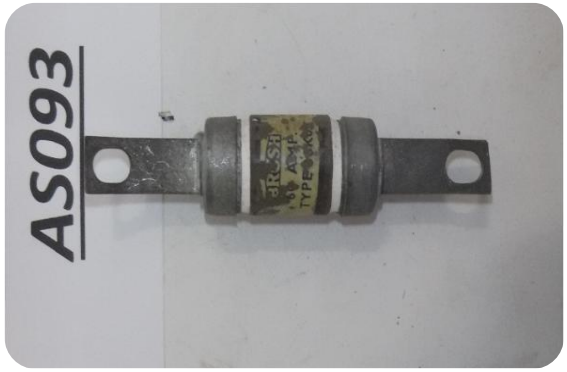
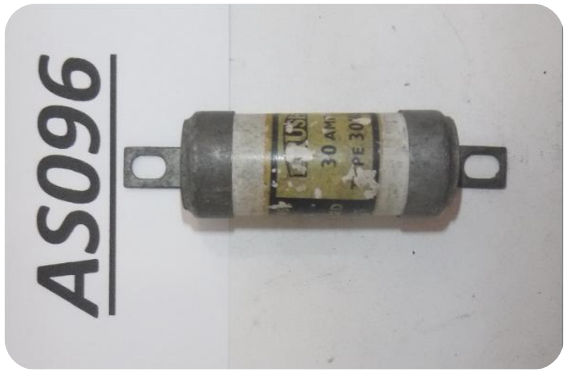
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bowthorpe Australia	**200**	 168273-102	EA0, 200A	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Bowthorpe Australia	**400**	 211124/AS001	440V 400A fuse Type EED	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**2**	 174783-001-AS050	2F06, 2A, 250VDC, B.S.88: Pt 1	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

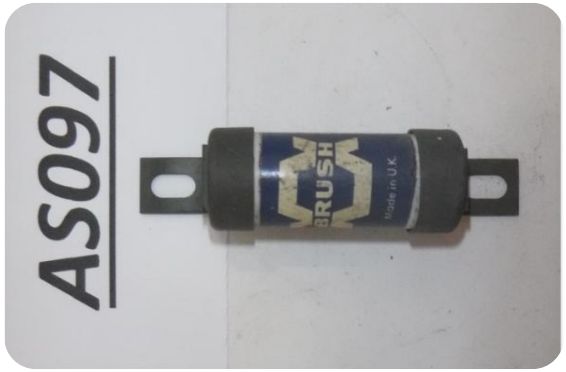
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Brush	**10**		F06, 10A, AC80, B.S 88, Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**15**		F0KZ, 15A, AC80, B.S 88, Class Q1, 415V	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**25**		25H07, 25A, AC5, B.S 88	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Brush	**30**		30H07, 30A, AC80, B.S 88, Q1, 500V	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**30**		60K08, 60A, AC5 (Label worn)	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**30**		30H07, 30A, AC5, B.S 88	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Brush	**40**	 OF00053-120718-AS25	63K09, BS88:1, 660V a.c. 80kA, 250V d.c. 40kA, Q1, made in U.K.	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**50**	 168273-97	50K07, 50A, AC80, B.S 88, Q1	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**60**	 168273-91	60K06, 60A, AC80, B.S 88, Q1, 415V	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Brush	**60**	 OF00053-120718-AS15	60KR71A, 60 AMP, ASTA (20) Certified, 415V, BS1361, 1971	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**60**	 168273-94	60K08, 60A, AC5, B.S 88 (label worn)	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**80**	 168273-68	80K09, 80A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Brush	**100**	 168273-89	100L14, 100A, B.S 88, AC 5	Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**400**	 54287-001-111	AC80 400A	No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**400**	 54093-001-014	415AC 46, Q1, Asta Cert, 400PJ30	Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Brush	**415**	 55738-001-013	415AC 46, Q1, Asta Cert, 80 MJ29	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush	**1600**	 174102-001-AS005	Reliance Fuse, LCU 1600, DK0966, 200,000 A A.c, HRCI-L, Class L	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush		 54287-001-004	300MJ31, Asta Cert	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Brush		 54287-001-061	25H07	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush		 54287-001-119	8-MJ29	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Brush		 P033786.002-AS012	Brush HRC - HRC Fuse - Class Q1, BS: 88: 1967, ASTA certified, 415 AC 46 - 415V - no country - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**2**	 174783-001-AS056	NSD2, 2A, 80kA, BS88.6:1988, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**4**	 174783-001-AS058	NSD4, 4A, 80kA, Asta 20 cert, BS 88.6 : 1988, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**5**	 221102/AS001	5A	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**6**	 P033768.003-AS016	NSD6, HRC, gG, 6A, BS88.6:1988, 550Vac 80kA, Made in India	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**10**	 54287-001-034	NSD10 GG 10a	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**10**	 OF00053-120718-AS06	10KRG85, 10 AMP, 415V, BS1361, 1971, 3.3W, made in India	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**16**	 174783-001-AS055	NSD16, 16A, 80kA, gG, BS88.6:1988	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**16**	 54287-002-034	AA025, HRC, gG, 550V ac, 80kA, Asta Cert	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**16**	 54287-002-035	AA016, HRC, gG, Asta 20 Cert	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**32**	 54287-001-081	NSD32 GG 32A	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**60**	 54287-002-022	60KR85, HRC, Asta 20 cert, 415V, 4.5W	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**60**	 OF00053-120718-AS02	60KR85, 60AMP, ATSA (20) Certified, 415V, BS1361, 1971, 15W	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

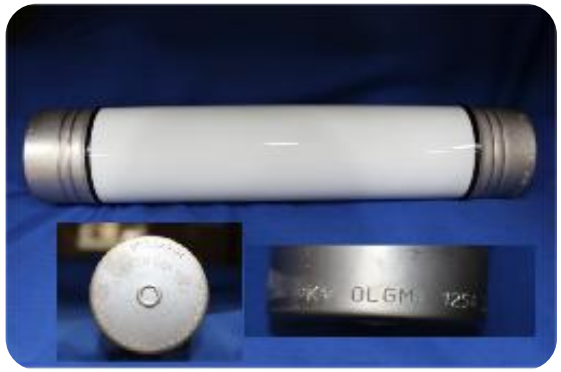
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**63**	 174783-001-AS057	ESD63, 63A, 80kA, BS88.6: 1988, Asta 20 cert, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**63**	 54287-001-033	BA063 gg 63A	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**63**	 54287-001-044	BAO63 gg 63A	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**100**	 54287-002-007	CD100, HRC gG, 500V ac, 80kA, Asta 20 cert	No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**100**	 54287-001-006	100LRS5, HRC	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**100**	 54287-002-044	100KR85, HRC, 415V, 6.1W	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**100**	 OF00053-120718-AS10	100LR85, 100 AMP, ASTA (20) Certified, 415V, BS1361, 1971, 5.0W	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**125**		Bussman OLGMA	Current Stock Item No. 182560	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**200**	 54287-002-004	gG, DD200, HRC, Asta 20 cert, 415V, 80kA	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**200**	 54287-002-063	NH1, gG/gL, 200A, 120kA, 500V, 200NHG1B, 47/13	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**200**	 54287-002-064	NH1, gG/gL, 200A, 120kA, 500V, 200NHG1B, 23/15	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**200**	 54287-002-065	NH1, gG/gL, 200A, 120kA, 500V, 200NHG1B, 19/15	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**200**	 P033786.002-AS003	200A, gG, DD200 HRC, ASTA 20 CERT, BS88:2:1988, 415VAC.80KA, Made in India	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**250**	 54287-002-042	gG, ED250, Asta 20 cert, 415V, 80kA	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**315**	 54287-002-068	gG, ED315WO, Asta 20 cert, 415V, 80kA	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**315**	 P033786.002-AS012	315A, Gg, ED315WO, ASTA 20 CERT, BS88 : 2 : 1988, 415AC.80kA	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**400**	 54287-001-153	400LMMT	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**400**	 54287-002-070	gG, ED400EA, HRC, 415V, 80kA	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Bussmann	**400**	 54287-002-072	gG, EF400EA, HRC, 415V, 80kA	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**1000**	 174102-001-AS008	TKTU-1000, Limitron, 0035308, 1000A, Class L, current limiting, AS IR200kA, UL 600Vac IR 200 kA, CSA 600Vac IR200kA	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Bussmann	**1200**	 174102-001-AS010	KTU-1200A, ND87-82, Limitron, 1200A, current limiting,UL 600Vac IR 200kA, CSA 600Vac IR 200kA, Class L	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

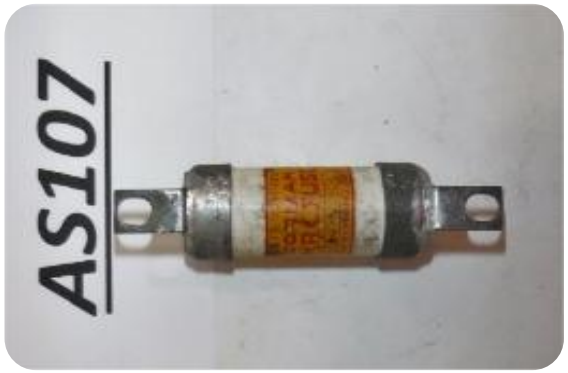
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Century Electric	**2**	 P033768.003 - AS001	2A,	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Century Electric	**10**	 168273-100	MN, 10A, AC5, Q type	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Century Electric		 168273-99	no markings, no other markings	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Cubacc	**100**	 P034596.001/ C0002	3E100M125, 100A 415 V.A.C. BS88. Pt.2 Ref A4 West Germany	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**10**	 174783-001-AS060	AA0, 10A, AC5, 460VDC4, BS 88, Class Q, Asta certified,	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**20**	 P033786.002-AS012	NITD 20, Q1, BS88.2:1975, C22.2, No106, 80kA, 20A, HRC H-MISC, 200kA, IEC269-2, AS2005-2	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman	**30**	 168273-107	AA0, 30A, B.S.88, AC5, 460DC40, Class Q	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**30**	 168273-108	AA030A, 30A, B.S.88, AC80, 250DC40, Class Q1, IEC 269-1 8.5.8	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**100**	 54287-001-073	Smith CD100 Q1 100A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman	**100**	 54287-001-087	100 A DC4 Class Q	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**200**	 54287-001-023	Hawker Siddley, OSDD200 CLASS Q1	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**200**	 54287-001-120	Hawker Siddeley OSDD200	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman	**200**	 54287-001-122	Smith Cat No jsds	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**300**	 54287-001-140	Smith AC80	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**400**	 54093-001-005	Smith OSEF 400, HRC Fuse link, ac80, 415 V	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

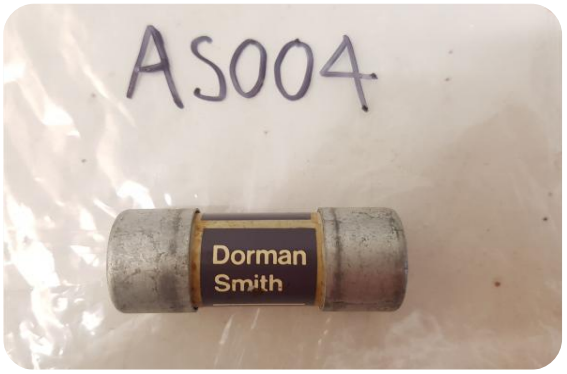
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman	**400**	 54287-001-024	Smith 400A Class Q1 Bs.88:part 5	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**400**	 54287-001-050	Smith OSED 400	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**400**	 54287-001-058	Smith AC80 400A	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

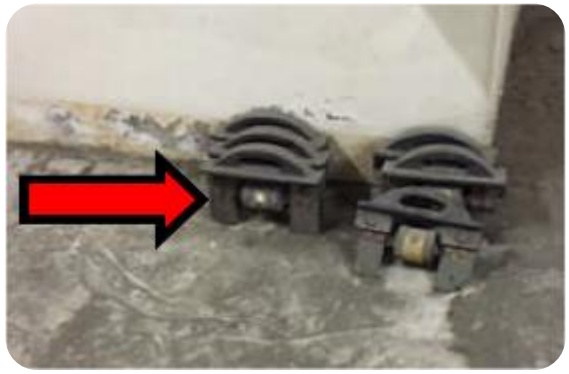
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman	**500**	 54287-001-025	Smith 500A class Q1 BS 88.1967	Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**600**	 54287-001-053	Smith SGF600	Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**35**	 174783-001-AS059	ESD35, 35A, 80kA, 250VDC40kA, Asta 20 cert, BS 88:1975, Q1, AS2005.1:1981, IEC 269.1: 1973, International Super Fuse	No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman	**60**	 176207-001-AS003	Super fuse, BAO60A, 60A, AC80, 25VDC40, IEC 269-1 8.5.8, Asta certified 2000,000A 55DV, Class Q1, BS88 1967	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**60**	 182621-001-004	RHC60A, 60A, asta certified, BS.1361 1971	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**63**	 174102-001-AS034	DSL63A, 63A, BS88-4: 1976	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman	**500**	 P033786.002-AS002	OSFF 500, 500A,	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**800**	 181698-001-001	SGF800	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Dorman	**800**	 55738-001-001	800A, 550V, Class Q1, Non-indicating (Offset tag - Network Protector Fuse)	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Dorman Smith	**100**		DS OSDD	Current Stock Item No. 85217	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Dorman Smith	**200**		DS OJSDS,	Current Stock Item No. 85688	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Dorman Smith	**630**		DS SGF, Siemens 3NW1-351/S	Current Stock Item No. 85597	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Driescher Rheydt	**400**	 167851-1	VDE 0630 – 400A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Driescher Rheydt	**400**	 167851-2	VDE 0660 - 400AT 500V	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Driescher Rheydt	**425**	 167851-3	VDE 0660 – 500V	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Driescher Rheydt	**425**	 174102-001-AS035	VSE0660, 425AT, 425A	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Driescher Wegberg	**2**	 210803/AS001	NHGY-2 500V 120kA, 1981	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Driescher Wegberg	**120**	 754-SYDEN202874-003	NHGY-2 500V 120kA 1981	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**50**	 54287-002-038	50SB4, HRC Asta 20 cert, 415 V ac, 80kA, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**63**	 54287-001-083	63SB4, 63A GG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**100**		EATON AA100SF5SWP	Current Stock Item No. 85217	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**100**	 54287-002-039	100SD5, HRC Asta 20 cert, 415 V ac, 80kA, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**100**	 54287-002-041	100JSS92WP, Asta 20 cert, HRC, 415V, 80kA	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**200**	 EATON AA200SF6SWP	EATON AA200SF6SWP	Current Stock Item No. 85423	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**200**	 EATON AA200JSS92WP	EATON AA200JSS92WP	Current Stock Item No. 85688	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**200**	 176207-001-AS004	200SF6SWP, 200A, BS88.2:1988, 80kA, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**200**	 55738-001-009	400JSS92 WP 200A	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**250**	 P033786.002-AS012	EATON - HRC, 250JSS92WP - BS88-5: 1988, 415V AC 80kA, 250A, ASTA certified - 415V - no country - no date	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**300**	 EATON AA315SF7SWP	EATON AA315SF7SWP	✓ Current Stock Item No. 85506	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**315**	 55738-001-004	315JSS92WP, Asta 20 Cert, 415V ac, 80kA	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**400**	 174102-001-AS015	400SH8SWP, type gG, 400A, BS88.2:1988, 80kA	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**400**	 176207-001-AS005	400SFSWP, 400A, BS88.2:1988, 80kA, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**400**	 176207-001-AS006	400SH8SWP, 400A, BS88.2:1988, 80kA, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**400**	 54093-001-010	400JSS82WP, ASTA 20 Cert, 415V ac, 80kA	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**400**	 54287-001-019	400JSS92 WP 400A	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**400**	 P033786.002-AS006	400JSS82WP, ASTA 20 CERT, BS88. 5 : 1988, 415Vac 80kA, 400A	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**500**	 54287-002-010	500SH9SWP, HRC, 415V ac, 80kA, gG	Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**630**	 EATON AA630SH9SWP	EATON AA630SH9SWP	Current Stock Item No. 85597	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**630**	 EATON AA630SY9S	EATON AA630SY9S	Current Stock Item No. 85589	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

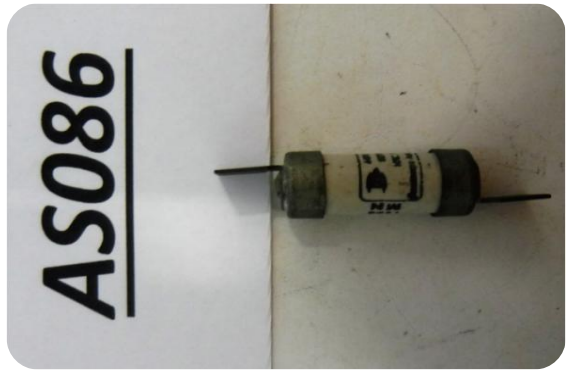
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	**630**	 176207-001-AS007	630JSS92WP, 630A, BS88.5:1988, 80kA, gG	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**630**	 54287-002-078	630SY9S, HRC, 415 V ac, 80kA, gG	!	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Eaton	**630**	 P033786.002-AS007	630SY9S, BS88.2:1988, 415Vac 80kA, 630A Gg, 630A HRC	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Eaton	800		EATON AA800SY10S	✓ Current Stock Item No. 85613	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**800**	 54287-001-114	800JSS92WP	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Eaton	**800**	 54287-002-081	800SH10S	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

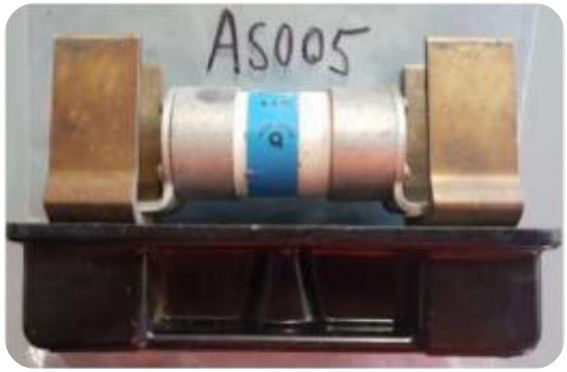
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Electric Pty. Ltd.	**0**	 754-SYDEN202874-AS10,10B 10A, 11B, 12A, 12B	Electric Pty. Ltd. 240 Volt	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**2**	 174102-001-AS038	N.17, 1.5A, cartridge fuse	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**10**	 168273-86	MN, 10A, AC5, B.S 88, QFF	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
EMP	**20**		968MN, 20A, AC 5, B.S. 88, QFF	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**20**		MN, 20A, AC5, BS88	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**20**		MN, 20A, AC5, BS88	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
EMP	**80**	 P033768.003 - AS005	TYPE ENAA, 80A, AC5,HRC FUSE, BS88, FUSING FACTOR Q	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**100**	 168273-87	ENAA, 100A, AC5, B.S 88, Fusing Factor Q	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**100**	 54287-001-074	AC5 100A BS88 Q	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

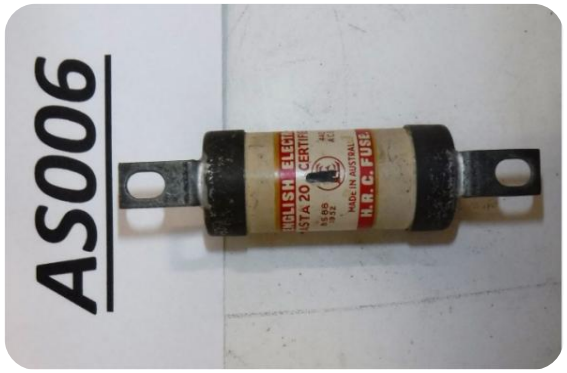
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
EMP	**200**	 184344-001-001	ENA 2000, AC5, Fusing Q factor	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**250**	 54287-001-107	AC5 3S/EJB	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP	**300**	 54287-001-135	3S/EJB	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

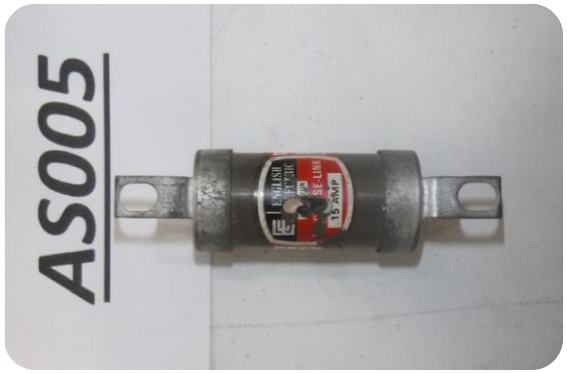
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
EMP	**400**	 168273-88	3SVEE, 400A, AC5, Q	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
EMP Electrical London	**2**	 2101006/AS001	11kV 2 Amp	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric		***All English Electric Fuses with Chocolate Brown coloured fuse bodies are to be treated as Asbestos Containing.*** ***All other EE Fuses to be checked as per the following entries.***	**ANY**	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**2**	 168215-1	NS2, 2A, B.S. 88, AC80, Class Q	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**4**	 174102-001-AS025	NS4, 4A, BS88, AC5	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**10**	 168215-6	TIA10, 10A, B.S.88, AC5	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**15**	 168215-5	TIA15, 15A, B.S.88, AC 80, Class Q1	Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**15**	 168215-8	TIA15, 15A, B.S.88, AC 80, Class Q1	Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**20**	 174102-001-AS024	TIA20L, type gG, 20A, BS88:2:1988, 80kA, AS2005.21.2	No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**20**	 168215-4	NS20, 20A, B.S.88, AC5	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**20**	 174783-001-AS080	TIA 20, 20A, Indicator, AC80, BS88:1967, Class Q1, Asta 20 certified	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**20**	 174783-001-AS081	TIA 20, 20A, Indicator, AC80, BS88:1967, Class Q1, Asta 20 certified	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**25**	 54287-001-075	TIA25 25A	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**30**	 174783-001-AS082	D3030, 30A, Asta certified, BS1361	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**30**	 51378-001-22		Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**30**	 54287-001-030	232TK 30A	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**35**	 54287-001-090	TIS35	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**35**	 168215-14	TIS35, 35A, B.S.88, AC4	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

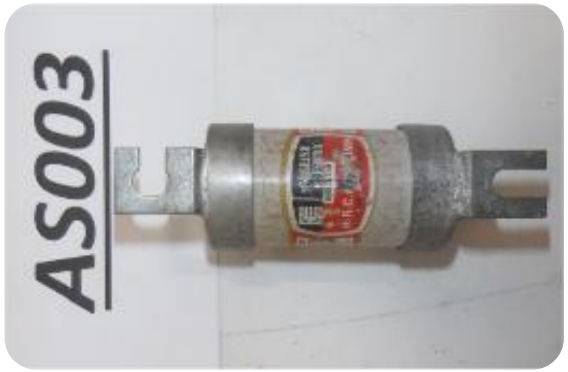
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**35**	 168215-24	TIS35, 35A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**35**	 54287-001-062	440	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**40**	 168215-20	TIS40, 40A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**40**		TIS40, 40A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**50**		TIS50, 50A, B.S.88, AC5	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**50**		TIS50, 50A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**50**	 168215-3	TIS50, 50A, B.S.88, AC80, CLASS Q	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**60**	 754-SYDEN202874-AS09	English Electric TCP100MI60A	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**60**	 168215-23	TIS60, 60A, B.S.88, AC4 & AC5	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**60**	 168215-27	TIS60, 60A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**63**	 754-SYDEN202874-AS18	English Electric TIS63L/TYPE gG 63A	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**80**	 54287-001-072	TCP 80A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**100**	 168215-30	581C, 100A, B.S.88, AC4 & AC6	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**100**	 168215-9	TCP, 100A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**100**	 54287-001-099	TCP100M150	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**100**	 54287-001-131	TC 100A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**100**	 55738-001-012	HRC Fuse, 440AC Class Q1, 95TY,	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**150**	 168215-13	TF, 150A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**160**	 754-SYDEN202874-AS05 and AS06	English Electric TCP 100M 160A	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**160**	 54287-001-121	TFP.160A	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**200**	 168215-10	OTF, 200A	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**200**	 168215-18	TF, 200A, B.S.88, AC80, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**200**	 54287-001-143	231TF	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**300**	 174783-001-AS083	238TK 355129, 300A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**350**	 54287-001-031	OTM.350A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**350**	 54287-001-134	R5 TM350A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**400**	 54287-001-055	SCC OTM F 400A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**440**	 51378-001-25		✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**500**	 168215-29	OTTM, 500A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**500**	 54093-001-008	ISI Cert, 440V, 46ka Made in India, TMM.500A, EE patient no. 355129	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**500**	 54287-001-104	TTM 500A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**500**	 54287-001-123	387TW500A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**600**	 168215-31	J , 600A, B.S.88	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**600**	 54287-001-105	TLM 600A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**800**	 50753-002-003	252TL/ 800A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**800**	 50753-002-004	PAT.35512A/ 852 TL 800A (Offset Tag - Network Protector Fuse)	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**800**	 54287-001-057	TLT 800A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**800**	 55738-001-002	440 AC5, B.S.88, Asta 20 Certified (Made in India) TLU800	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**1000**	 50753-002-002	AC5 List No. S.1428 /1000A F.F.15 /440V AC5 (Offset Tag - Network Protector Tag)	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

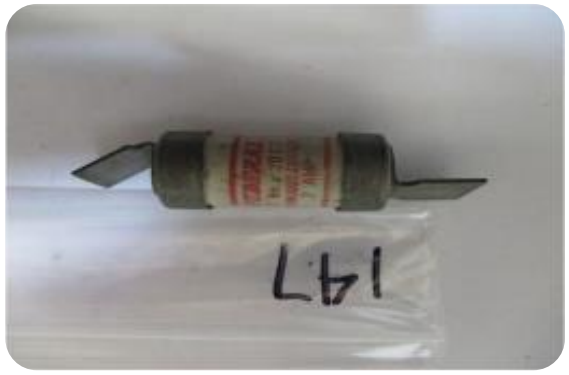
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**1000**	 54287-001-151	CAT 550 AC80 TX1000A	Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**1200**	 176207-001-AS008	C1200L, 1200A, HRC current limiting, 50/60 cycle, Class L	No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**1200**	 55738-001-003	550V, Class Q1, Cat 550AC80, Asta20 Certified TXU1200	No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

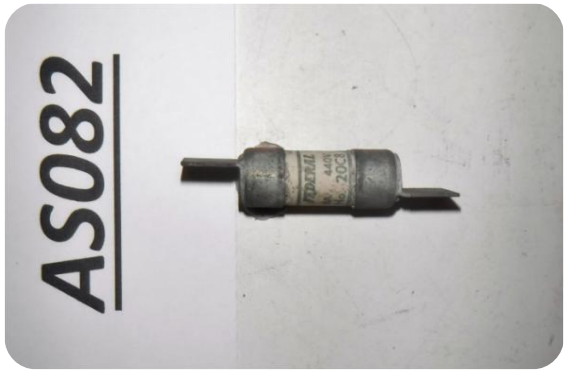
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
English Electric	**1200**	 54287-001-052	550AC80 TX1200A	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric	**1600**	 174102-001-AS006	C1600L, current limiting fuse, 1600A, Class L, 50/60 cycle	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
English Electric		 P033786.002-AS012	English Electric - HRC Fuse Link - Type J, Class Q1, BS88: 1967, 415V AC, Category: 415AC46, ASTA certified - 415V - England - no date -	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**2**	 174102-001-AS014	20T2, 2A, AC5	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**2**	 174783-001-AS068	20F2, 2A, AC5, BS88, S.A.A.0135	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**2**	 54287-001-147	CAT NO 20C2	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**6**	 174783-001-AS073	30B6, 6A, AC5, BS88, S.A.A C135	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**6**	 51378-001-20	20T 6'6A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**8**	 168273-82	20C8, 8A, AC5, B.S.S88, S.A.A C135	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

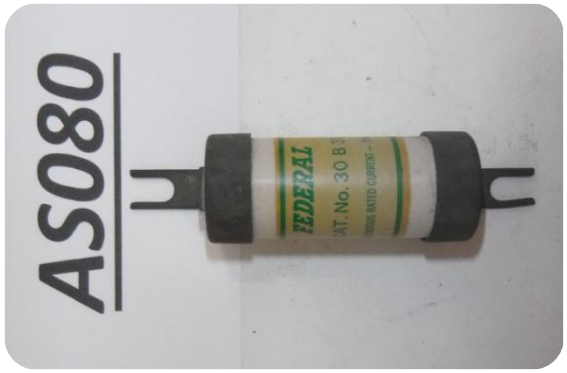
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**8**	 168273-83	20C8, 8A, AC46, B.S88, AS C135, Class Q1	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**10**	 168273-81	20T10, 10A, AC5, B.S.S88, S.A.A C135	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**10**	 174783-001-AS070	30T10, 10A, AC5	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**15**	 174783-001-AS069	30T15, 15A, BS 88, S.A.A C135	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**15**	 174783-001-AS072	30B15, 15A, BS 88, S.A.A C135, AC 46	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**15**	 168273-84	20C15, 15A, AC46, B.S88, AS C135, Class Q1	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

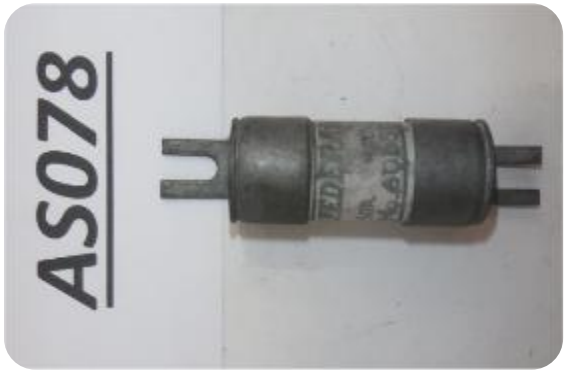
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**20**	 174783-001-AS071	20T20, 20A, AC5, BS88, S.A.A C135	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**20**	 174783-001-AS075	30B20, 20A, AC46, Class Q1, BS 88-195, AS - C135	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**30**	 168273-80	30B30, 30A, AC46, B.S.S88, AS-C135	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

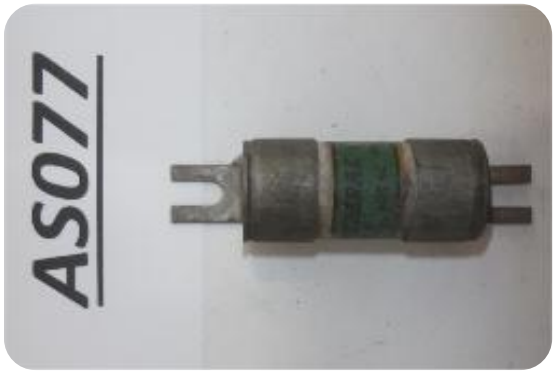
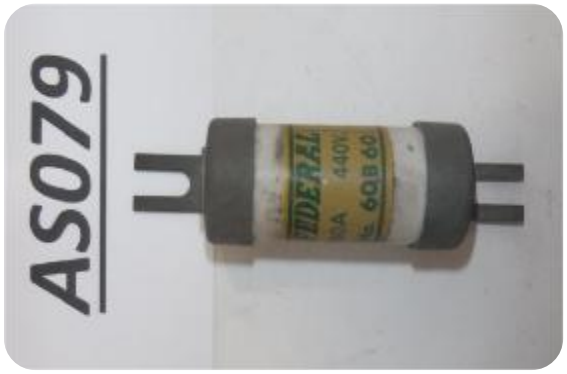
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**32**	 174783-001-AS074	32 B 5, 32A, CA A2, AS 2005	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**32**	 182621-001-006	63B32, 32A, A3, AS2005	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**35**	 174783-001-AS066	LK35, 35A, AC4	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**45**	 174783-001-AS067	LKB 45, 45A, AC4	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**45**	 182621-001-007	SK-45, 45A, AC2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**50**	 168273-78	60B50, 50A, AC 5, B.S.S88, S.A.A C135	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**60**	 168273-77	60T60, 60A, AC5	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**60**	 168273-79	60B60, 60A, AC46, B.S.S88, S.A.A C135	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**80**	 P033768.003-AS015	CAT.No.100 B 80, CONTINUOUS RATED CURRENT 80 AMP, H.R.C, 440V-AC43, CLASS 01, BS.88-1967, AS-C135	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**100**	 168273-76	100T100, 100A, AC5	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**100**	 754-SYDEN202874-AS01 and AS02	Federal 500V 100A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**100**	 754-SYDEN202874-AS16	500V. 100A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**100**	 174102-001-AS013	100B 100V, 100A, HRC AC46, BS88, S.A.A C135	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**100**	 54287-001-014	100Amp	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**100**	 54287-001-069	100B 100C HRC AC46	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**100**	 54287-001-097	100B100	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**100**	 P033768.003-AS019	CAT.No.100 B 100, CONTINUOUS RATED CURRENT 100 AMP, H.R.C, 440V-AC46, CLASS 01, BS.88.1957, AS-C13?	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**200**	 54287-001-110	No 200B	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Federal	**400**	 54093-001-001	Cat. No. 40413 400C FAWP 400V-400A-01	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal	**400**	 54287-001-117	CAT No 400B	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Federal		 754-SYDEN202874-AS03	Federal 601 FV	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Ferraz Shawmut	**10**	 OF00053-120718-AS13	T200761, 22x58, 10A, 690V~, I1=80kA 690V~, I1=120kA 500V~, IEC269-2-1, NFC63210	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Ferraz Shawmut	**100**	 182621-001-001	Linder, NH000GG50V100, W05Y10GP, 100A, gL/gG, 120kA, NH000, korronsionsfest, IEC60269-2, B219122, 1B663	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Ferraz Shawmut	**200**	 /2101006/AS002	BTFP42V200 415V 200 Amp AC 80kA	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Ferraz Shawmut	**1000**	 174102-001-AS009	Amp-Trap 2000, Time Delay, 1000A, 600V AC, Class L Fuse, A4BQ1000, FP07-37, 200000A IR 500V DC 198L, current limiting 300000 IR 600V AC,	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Ferraz Shawmut	**1200**	 174102-001-AS003	A4BY1200, 1200A, Class L, form 480, 200,000A IR	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Ferraz Shawmut	**1200**	 P033786.002-AS001	AMP-TRAP 2000, A4BO1200, 1200A, 600V AC or Less, Time Delay, Class L Fuse, 200,000A IR 600V AC, 100,000A IR 500V DC, Current Limiting, 300,000A IR 600V AC	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Ferraz Shawmut	**1600**	 174102-001-AS007	Amp-Trap 2000, Time Delay A4BQ1600, FP34-31, 1600A, Class L, 200000A IR 600V AC, 10000A IR 500V DC, current limiting, 300000A IR 600V AC	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Fuseco Rizner	**25**	 754-SYDEN202874-AS17	TIA25 / 25AgG/415C	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
FuseMaster	**6**	 174102-001-AS026	NS6, gG, 6A, 80kA, AS2005, BS88, IEC269-2-1	✓ Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
FuseMaster	**10**	 54287-002-037	NS10, gG, 80kA, 500V ac,	Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
FuseMaster	**20**	 54287-001-085	NS20 20A GG	Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
FuseMaster	**32**	 54287-002-019	NS32, gG, 80kA, 50V ac,	Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Fusemaster	**63**	 54287-002-016	TIS63, 63A gG, 80kA, 500 V ac, 150521	✓ Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Fusemaster	**80**	 54287-002-015	2258F-80, 80A, 80kA, 415V ac, 150425	✓ Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
FuseMaster	**100**	 OF00053-120718-AS26	TC100, 100 A gG, 80 kA 500V AC, AS2005 BS88, IEC 269-2-1	✓ Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
FuseMaster	**125**	 174102-001-AS027	TF125, gG, 125A, 80kA, AS2005, BS88, IEC 269-2-1	Current Stock Item	✓ Manufacturers declaration that fuses do not contain asbestos. ✓ May be used and disposed of as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
GE Power Controls	**2**	 182621-001-005	Red spot, NIT2, 2A, 80kA, 40kA 250V DC, type gG, asta 20 cert, BS88-2 1988, IEC269-2-1	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GE Power Controls	**80**	 174102-001-AS037	TC80, type gG, 80A, BS99-2-1988, 80kA, 40kA 350V DC, IEC 269-2-1	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**2**	 54287-001-080	NS2 GG	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**2**	 54287-001-093	NS2	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**4**	 168273-61	NS4, 4A, B.S.88:6, 80A, AS2005.29, type gG	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**6**	 168273-64	NS6, 6A, BS88-1, 80A, Complies with AS 2005-1, Class Q1, Pat no. 2061639	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**6**	 174783-001-AS064	NS6, gG, 6A,Asta 20 cert, BS88:6:1988, 80kA, AS2005.29, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**10**	 168273-62	NS10, 10A, B.S.88:6, 80A, AS2005.29, type gG	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**10**	 168273-65	NS10, 10A, BS88-1, 80A, Complies with AS 2005-1, Class Q1, Pat no. 2061639	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**10**	 168273-69	TIA 10, 10A, B.S.88-2, Complies with IEC 269-2, AC80, 250DC40, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**10**	 174102-001-AS011	NS10, 10A, BS 88-2 1975, Asta cert 80kA 415V AC, 40kA 250V DC, Class Q1, complies with IEC 269-2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**10**	 P033786.002-AS012	NS10, Type gG, 10A, Asta20 cert, BS88:6:1988, 80kA, AS2005.29	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**10**	 54287-001-132	Y10PF	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**16**	 168273-63	NS16, 16A, B.S.88:6, 80A, AS2005.29, type gG	✓ Current Stock Item	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

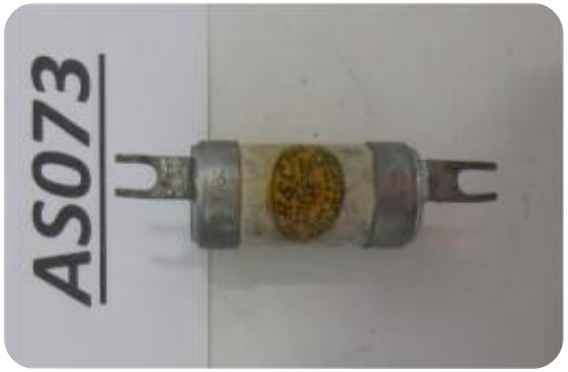
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**16**	 174102-001-AS020	NS16, 2061639, 16A, Class Q1, BS88-1 1975 , 80kA, AS2005-1	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**16**	 174102-001-AS021	NS16, type gG, 16A, BS88:6:1988, 80kA, AS2005.29	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**16**	 168273-66	NS16, 16A, Complies with IEC 269-2 (label torn)	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**16**	 168273-67	TIA 16, 16A, B.S.88-2, Complies with IEC 269-2, AC80, 250DC40, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**20**	 54287-001-076	TIA20	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**20**	 168273-72	Y20QF, 20A, B.S.88, AC5	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

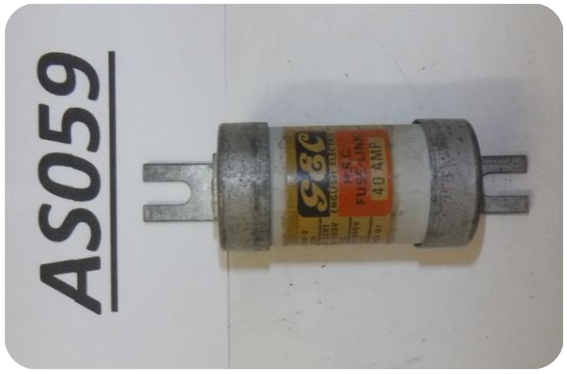
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**30**	 168273-73	Y30RA, 30A, B.S.88, AC5, 460DC4,	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**32**	 168273-68	TIA 32, 32A, B.S.88-2, Complies with IEC 269-2, AC80, 250DC40, Class Q1	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**32**	 168273-71	TIA 32, 32A, B.S.88:2, 80A, 460DC40, AS2005:21.2, type gG	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**32**	 174102-001-AS019	TIA32L, type gG, 32A, BS88:2:1988, 80kA, AS2005.21.2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**32**	 54287-001-148	English Electric TIA 32	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**35**	 54287-001-089	TIS35	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

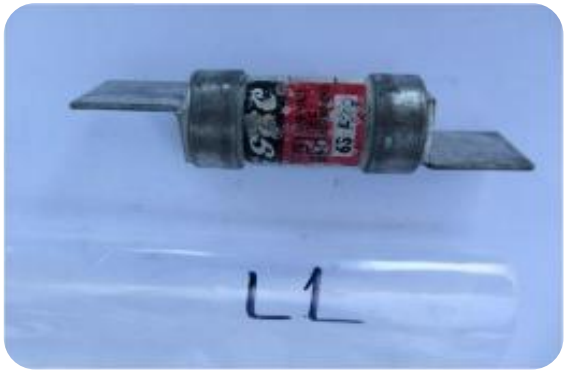
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**40**	 54287-001-016	BS88.2 80kA 2061689	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**40**	 54287-002-040	TIS40L, gG, Asta 20 cert, 415 V ac, 80kA,	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**40**	 168273-59	TIS40, 40A, B.S.88-2, Complies with IEC 269-2, AC80, 250V40, Class Q1	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

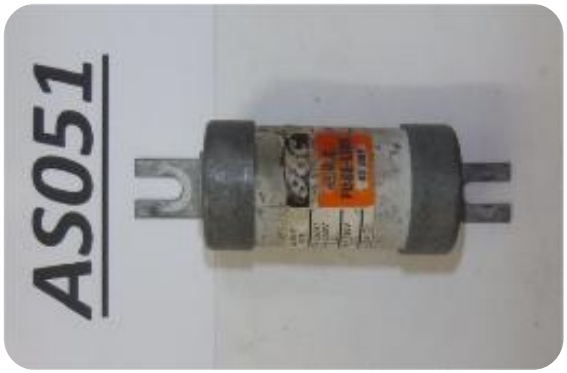
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**50**	 182621-001-003	fusegear TIS50, 50A, 2061639, complies with AS 2005-2, ASTA Certified, BS88-2 1975, 80kA, 460V DC, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**60**	 OF00053-120718-AS21	RHLF60, 33kA, 415V A.C., BS1371-1971, BS88-1-1975, made in England, 148	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**63**	 174783-001-AS065	ES63, 63A, Asta 20 cert, BS88: 6: 1988, 80kA, IEC 269-1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**63**	 54287-001-005	TIS63L Type gG 63A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**63**	 54287-001-077		⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**63**	 54287-001-108	List Numb TIS63	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**63**	 168273-51	TIS63, 63A, B.S.88-2, Complies with IEC 269-2, AC80, 250V40, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**80**	 168273-52	TCP, 100A, B.S. 88, 80A, 250DC40, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**100**	 168273-60	TCP, 100A, B.S.88-2, Complies with AS2005-2, AC80, 460DC40, Class Q1, Pat no. 2061639	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**100**		GEC OTC	Current Stock Item No. 85217	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
GEC	**100**	 174783-001-AS061	OTC 100, 2061639, 100A, 80kA, BS88-2: 1988, 40kA350VDC, IEC269-2-1, gG	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**100**	 174783-001-AS063	OTC100, 100A	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**100**	 54287-001-002	TCP100 Type gG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**100**	 54287-001-007	TCP 100M160 type gG 100A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**100**	 54287-001-060	TC100L	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**100**	 168273-53	TCP, 100A, B.S. 88, 80A, 250DC40, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**160**	 176207-001-AS009	TF160A*, BS88-2:1975, Asta Cert 80kA, 40kA250V DC, Class Q1. Complies with IEC 269-2	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**160**	 54287-001-027	Alstom Red Spot 40kA 25V TCP100M16OA	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**200**		GEC OTF	Current Stock Item No. 85423	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
GEC	**200**		GEC 0835 TJ 200,	Current Stock Item No. 85688	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
GEC	**200**		Y200VB, 200A	Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**300**		GEC OTKF, DS OSED	✓ Current Stock Item No. 85506	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
GEC	**400**	 174102-001-AS012	TM400L, Type gG, 400A, BS88:2:1988, 80kA, AS2005.21.2	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**630**		GEC TLT	✓ Current Stock Item No. 85589	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**630**	 54287-001-138	TTM630A	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC	**800**		GEC TLT, DS SGG,	✓ Current Stock Item No. 85613	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
GEC	**800**	 168273-70	252TL, 800A, B.S.88-2, Complies with IEC 269-2, AC80, 250DC40, Class Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC	**600 / 630**		GEC TLM	Current Stock Item No. 85506	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
GEC		 168273-74	JS630, no other markings	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC		 P033786.002-AS012	MEM - 250JSS92WP - 250A, BS 88: 5: 1988, AC 80 - 415V - United Kingdom - no date - AS002	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC		 P033786.002-AS012	GEC - JP400 - BS88-5: 1988, 415V AC, 80kA, ASTA certified - 415V - United Kingdom - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC		 P033786.002-AS012	GEC - HRC Fuse Link - Type J, Class Q1, BS88-5; 1980, 415V 80kA AC, list no: JS630 - 415V - England - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC		 P033786.002-AS012	GEC - HRC Fuse Link - Type J, Class Q1, BS88-5: 1980, 415V AC 80kA -415V - England - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GEC		 P033786.002-AS012	GEC - HRC Fuse Link - Type J, Class Q1, BS88-5: 1980, 415V AC 80kA, ASTA certified - 415V - England - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
GEC Alsthom	**250**	 SMPL-MC-210701-01	NHG 2gL, 120KA 500V, DIN 43620, IEC 269-2-1	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Gould	**2**	 54287-001-092	NFC 63 210 16513	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
GS	**75**	 174102-001-AS031	GSA75, 75A, 100kA, BS88-4 1988, IEC269-4	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Hazemayer Holec	**16**	 174783-001-AS054	TIA, 16A, 80kA, Asta Cert, Q1, BS88 1975	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Hazemayer Holec	**20**	 174783-001-AS053	TIA, 20A, 80kA, Asta Cert, Q1, BS88 1975	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Hazemayer Holec	**800**	 P033786.002-AS012	Hazemayer Holec - TLM 800A - Q1, BS88-2:1975, 415V AC 80kA, ASTA certified - 415V - United Kingdom - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Henley	**100**	 174102-001-AS030	30450, 581269, 100A, AC4, BS88:1952, FF I70	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Henley	**500**	 54287-001-100	30185 500/710	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
HH	**2**	 174102-001-AS036	NS2A, 2A, BS88-1975, AS2005-1,2, 80kA, class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Holec Isodin	**100**	 OF00053-120718-AS01	P851-1, gT-100A, ~500V, IEC 269-gI, NFC 63-210-gI, VDE 0636-gL	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
IPD	**2**	 174783-001-AS049	NS2, 2A, gG, 80kA, Asta 20 cert, BS88-6, IEC60269-2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
IPD	**6**	 54287-001-084	NS6 GG ^a	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
IPD	**10**	 P033786.002-AS012	NS10, Type gG, 10A, Asta20 cert, BS88-6, AC 80kA, IEC60269-2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
IPD	**10**	 P033786.002-AS012	NS10, Type gG, 10A, Asta20 cert, BS88-6, AC 80kA, IEC60269-2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
IPD	**16**	 54287-002-027	SK16, 20kA/440V ac	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
IPD	**16**	 54287-002-018	LC16, 6kA/250V ac,	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
IPD	**20**	 174102-001-AS029	NS20, gG, 20A, 80kA, BS88-6, IEC60269-2	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
IPD	**32**	 54287-002-033	TIA32L, gG, Asta 20 cert, 415V ac, 80kA,	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
IPD	**45**	 54287-002-023	SK45, 20kA/440V ac,	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
IPD	**60**	 54287-001-040	60ARHLF60	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
IPD	**60**	 54287-002-045	RHLF60, 33kA/415V ac,	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
IPD	**63**	 221102/AS004	ipd 63Amp UK63	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
IPD	**80**	 54287-002-032	RHLF80, 33kA/415V ac,	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

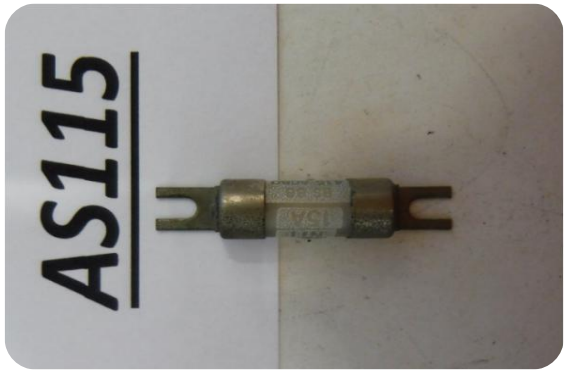
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
IPD	**100**	 54287-002-021	XK100, 33kA, a/440V ac,	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
IPD	**100**	 174102-001-AS028	RHLF100, 100A, 33kA, AS/NZS 60269.3.1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**10**	 174783-001-AS044	LC, 10A, AC4, BS88,	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**10**	 54287-002-029	LC, 240V	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**10**	 221102/AS005	MD 10A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**15**	 P033768.003-AS021	LC, 15A, BS1361, 240V, MADE IN THE UK	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**15**	 168273-115	NIT, 15A, AC80, B.S 88, Q1	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**20**	 54287-002-030	LC, 240V	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**20**	 OF00053-120718-AS18	ME60A, BS1361, 1971, 415V AC, ASTA (20) CERT, made in the UK	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**45**	 221102/AS002	LD45A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**100**	 54287-001-003	MF 100A B1361	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**100**	 54287-002-043	ME100A, 415V, AC, 80kA	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**100**	 55738-001-011	JHU100A, 415V ac, 80kA, Asta 20 Cert	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**100**	 55738-001-005	JSU, 100A, 415V ac, 80kA, Q1, Asta Cert	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**100**	 221102/AS003	ME100A	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**200**	 LAWSON OJSU200	LAWSON OJSU200	✓ Current Stock Item No. 85688	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson	**200**	 54287-002-052	OJSU200A, 415V ac, 80KA, Asta 20 Cert	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson	**200**	 55738-001-003	JHU200A, 415V ac, 80kA, Asta 20 Cert	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**250**	 54287-002-051	OJSU250A, 415V ac, 80kA, Asta 20 Cert	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson	**315**	 54287-002-055	OJSU315A, 415V ac, 80kA, Asta 20 Cert	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson	**315**	 P033786.002-AS005	ODJPU 315, 315A gU, 80kA 415V AC, IEC 60269-2, 11/16	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**400**	 54287-002-005	OJSU, 415V, Asta 20 cert, OJSU400A	No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson	**400**	 174102-001-AS016	ODJSU400, 400A, gU, 80kA, IEC 60269-2	No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**500**	 P033786.002-AS008	OJSU500A, BS88 - 2: 2010, IEC60269 - 2: 2010, 415V AC. 80kA, ASTA 20 CERT	No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**500**	 P033786.002-AS012	Lawson Fuses LTD - JSU 500A - Q1, BS88-5: 1980, 415V AC 80 kA, - 415V - United Kingdom - no date	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**630**		LAWSON	✓ Current Stock Item No. 85589	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson	**630**	 S4287-002-059	OJSU630A, 415V ac, 80kA, Asta 20 Cert	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**630**	 P033786.002-AS009	TT630A BS88 - 2: 1988, IEC60269 - 2, 415V AC. 80kA Gg, ASTA20 CERT, MADE IN THE UK	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**630**	 P033786.002-AS012	Lawson Fuses LTD - JSU 630A - Q1, BS88-5: 1980 415 AC 80kA, ASTA certified - 415V - United Kingdom - no date	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Lawson	**800**		LAWSON TLT800	✓ Current Stock Item No. 85613	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

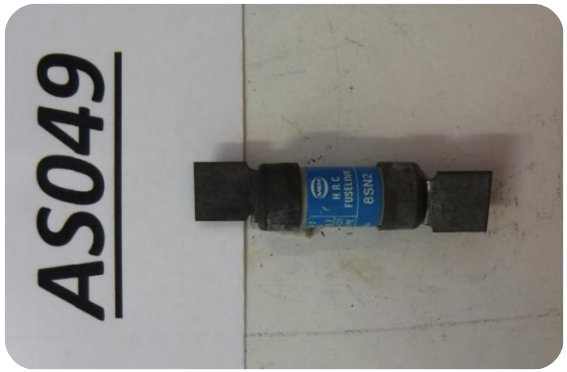
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Lawson	**800**	 54287-002-009	TLM 800A, Asta 20 cert, 415V, 80KA, gG	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson	**800**	 54287-002-013	OJKSU800A, 415V ac, 80kA	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Lawson		 54287-001-152	No Identifying marks	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

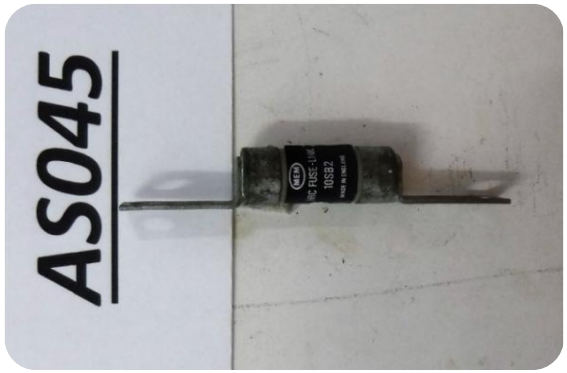
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**2**	 168215-37	2SN2, 2A, B.S.88-2 1975, IEC269-2/2A, AC80, 250DC40, Complies with AS2005-1:1981 & 2:1977, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**6**	 168215-40	6SN2, 6A, BS88:1967, NS Type, AC80, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**6**	 174783-001-AS079	6SB3, 6AA, AC80, AS2005.1: 1981 2:1977, BS88.2: 1975, IEC269-2/2A, Class Q1, 250DC40	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**6**	 54287-001-091	SSM2 6A Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**8**	 168215-49	8SN2, 8A, B.S.88-2 1975, IEC269-2, Class Q1, NS Type, AC80, AS 2005-2,1977	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**10**	 168215-41	10SB3, 10A, B.S.88: 2:1:1988, AC80, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

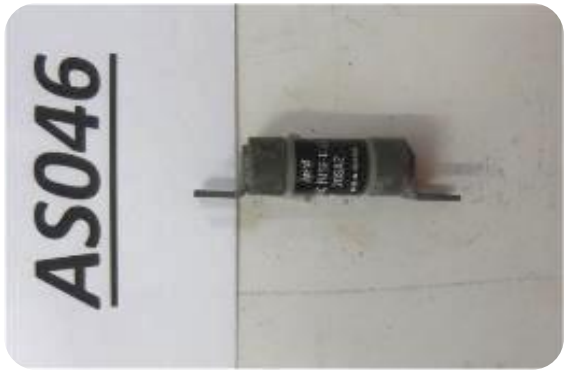
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**10**	 168215-45	10SB2, 10A, B.S.88 1967, Ref A2, Class Q1, AC 80, 250 DC40	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**10**	 54287-001-149	2567DC LIST NO 10SN2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**10**	 OF00053-120718-AS19	3010LC, BS88, 240V, 10A, made in UK	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

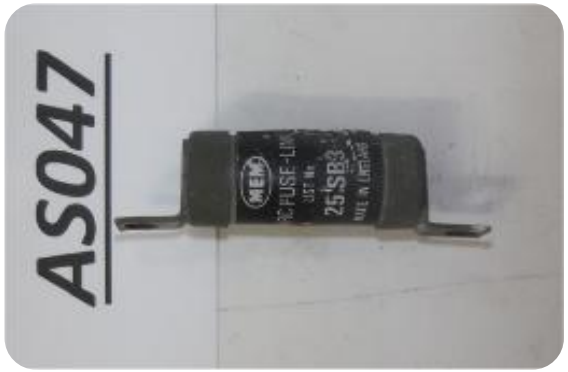
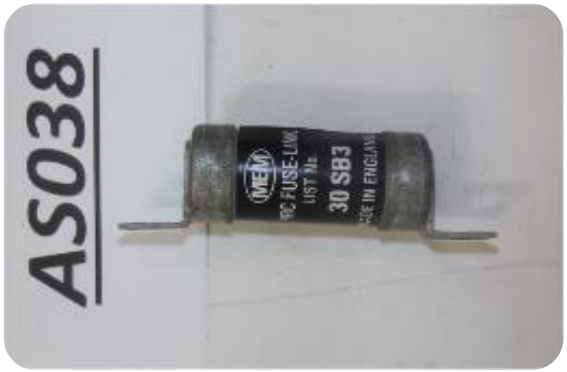
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**16**	 174783-001-AS077	16SN2, 16A, AS2005-1:1981, BS88-1975, IEC269.2/2A, AC80, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**16**	 55738-001-018	16 SB3, Asta 20 Cert, 415 V ac, 80ka, 1 A, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**20**	 168215-42	20SB3, 20A, B.S.88:2:1:1988, AC80, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**20**	 168215-46	20SA2, 20A, B.S.88 1967, Ref A1, Class 01, AC 80, 250DC40	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**20**	 54287-001-088	20SB3	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**20**	 54287-001-145	MEM-20SN2-20A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

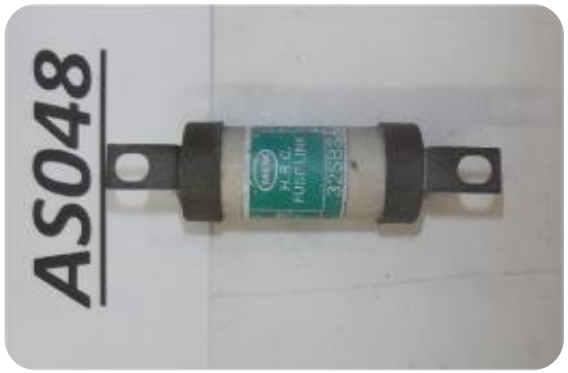
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**25**	 168215-47	25SB3, 25A, B.S.88 1967, Ref A2, Class Q1, AC 80, 250DC40	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**30**	 168215-38	30SB3, 30A, B.S.88, Ref A2, AC80, 250BC40, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**30**	 168273-50	30SN21, 30A, FFQ1, B.S.88:1967	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**32**	 168215-44	32SB3, 32A, B.S.88:2:, IEC269:2, AS 2005, 250V DC40, Class Q1, Ref A2, AC80	✓ No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
MEM	**32**	 174783-001-AS078	32SP, 32A, AC80, AS2005.1: 1981, BS88.1: 1988, IEC269-2/2A, Class Q1	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**32**	 54093-001-017	AsTA 20 Cet, 415V ac, 80kA, 32A, 9g, 32SP	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**32**	 54287-001-112	32SB3	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**32**	 168215-35	32SB3, 32A, B.S.88-2:1975, IEC269-2/2A, 1973/5, AS2005-2:1977, Class Q1, Ref A2, AC80, 250V DC40	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**32**	 168215-48	32SB3, 32A, B.S.88-2, 1975, 1EC269-2, Class Q1, Ref A2, AC80, 250DC40	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**35**	 P033786.002-AS012	EMCO (N.Z.) LTD, List no. 35SB4, 35 AMP, BS88:1967, Ref. A3, Class FF (label torn), ASTA certified, Category 415 AC80, N.Z. Licensee	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**40**	 168215-36	40SB4, 40A, BS88-2:1975, IEC269-2/2A, AC80, 250DC40, Complies with AS2005-1:1981 & 2:1977, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**40**	 55738-001-020	40SB4	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**50**	 168215-34	50SB4, 50A, B.S.88-2:1975, IEC269-2/2A, AC80, 250DC40, Complies with AS2005-1:1981 & 2:1977, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**60**	 168215-43	60SB4, 60A, B.S.88:1967, Ref A3, Class Q1, AC80, 250DC40	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**63**	 174102-001-AS033	63SP, 63A, IEC 269:1, AS2005, Class Q1, BS 88:1, 80 kA	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**63**	 174783-001-AS076	63SB4, 63A, 80kA, Asta 20 certified, BS88.2, Ref A3, IEC 269.2AS.2003, 250VDC40kA, Class Q1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**63**	 54093-001-016	415v ac 80kA SN3	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**63**	 54287-001-037	838A 63A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**63**	 54287-001-041	Class Q1 63A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**63**	 54287-001-094	63SB4 64A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**63**	 55738-001-019	63 SB4, Asta 20 Cert,	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**80**		MEM 804RL	✓ Current Stock Item No. H25771	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
MEM	**100**		MEM 100SF5SWP	✓ Current Stock Item No. 85217	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
MEM	**100**		100 SD5 100A	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**100**	 54287-001-071	ZPLBLFWP 100SFS - 100a	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**100**	 54287-001-086	100 SD5	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**100**	 54287-001-139	550AC80 250DC 40	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**100**	 54287-001-146	100 JXS6	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**100**	 55738-001-015	100 SF5SWP 415 V ac, 80kA, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**100**	 55738-001-017	100 SO5, Asta 20 Cert, 415 V ac, 80kA, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

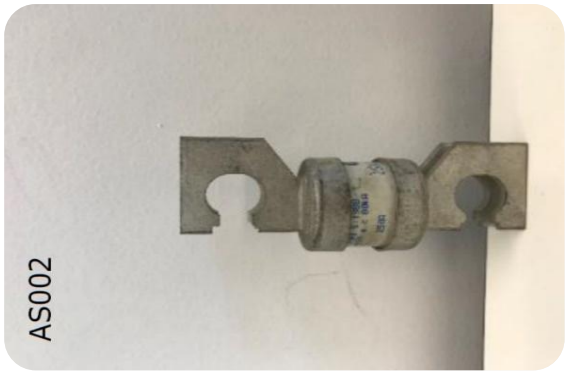
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**100**	 P033786.002-AS012	HRC Fuse link, 100AF5-100A, 100A, Weatherproof, Class Q1, Complies with AS2005- 1:1981-2:1977, BS88 - 2:1975, IEC 269-2/2A, 550 AC 80, 250 DC 40, When reordering add letters 'WP' to list no. marked on cap, ZPLBLFWP	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**200**	 MEM 200SF6SWP	MEM 200SF6SWP	✓ Current Stock Item No. 85423	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
MEM	**200**	 MEM 200JS92WP	MEM 200JS92WP	✓ Current Stock Item No. 85688	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**200**	 54287-001-133	200 SF6WP	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**200**	 54287-001-142	200 JSS92WP	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**200**	 55738-001-014	200 SF6SWP 2800 415V ac, 80kA, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**250**	 P034242.001 / C0002.AS002	MEM - 250JSS92WP - 250A, BS 88: 5: 1988, AC 80 - 415V - United Kingdom - no date - AS002	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**300**		MEM 315SF7WP	✓ Current Stock Item No. 85506	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
MEM	**315**	 176207-001-AS010	315JSS92WP, 315A, BS88:5:1988, 80kA, Asta cert 20, 3003	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**315**	 65738-001-021	315 SF7SWP	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**315**	 P033786.002-AS012	MEM - 315JSS92WP - 315A, BS88: 5: 1988 415V AC 80kA, ASTA	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**315**	 P033786.002-AS012	MEM - 315JSS92WP - 315A, BS88: 5: 1988 415V AC 80kA, ASTA certified - 415V - United Kingdom - no date	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**400**	 54093-001-012	400 SH8SWP 2800, 415V, 80ka, 9g (Small Barrel)	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**400**	 54287-001-020	400 SF8WP 400A GG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**400**	 54287-001-026	400 JSS92 WP 400A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**400**	 54287-001-113	Slotted 3 1/3 CTRS 400JS.8	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**500**	 176207-001-AS011	500SH9SWP, 500A, BS88:2:1988, 80kA, gG, 4303	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**500**	 176207-001-AS012	500JSS92WP, 500A, BS88:5:1988, 80kA, Asta cert 20, 4902	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**500**	 P033786.002-AS011	500JSS92WP, BS88:5:1988, 415V a.c, 80kA, Asta cert 20, 0603	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**630**	 176207-001-AS013	630SH9SWP, 630A, BS88:2:1988, 80kA, gG, 3202	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**630**	 176207-001-AS014	630SY9S, 630A, BS88:2:1988, 80kA, gG, 0504	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

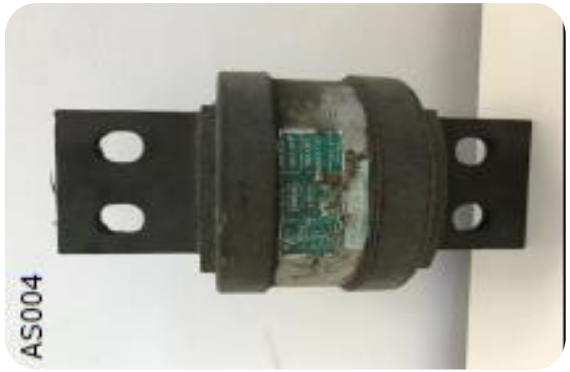
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**630**	 176207-001-AS015	630SY9S, 630A, BS88:2:1988, 80kA, gG, 5204	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**630**	 54287-001-101	630 JSS9 2WP	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**800**	 176207-001-AS016	800JSS92, 800A, BS88:5:1988, 80kA, 1203	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

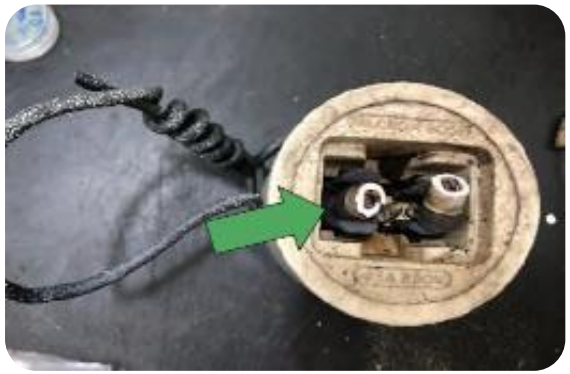
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM	**800**	 54287-002-075	800 SH10S	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM	**800**	 P033786.002-AS010	800SH10S, 800A, MADE IN UK, BS88 : 2 : 1988, 415V a.c 80kA, 800A gG	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM		 OF00053-120718-AS04	804RL, BS1361:1971, BOA, 415V AC, ASTA (20) CERT, made in the UK	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

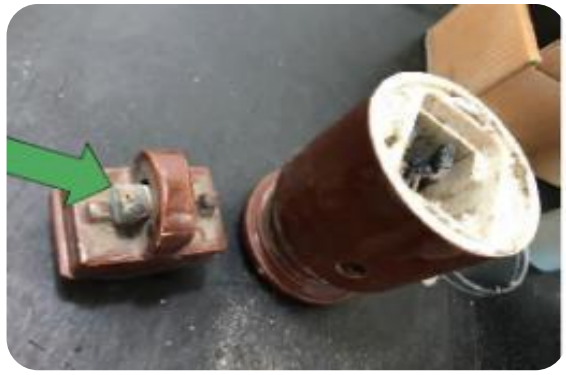
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
MEM		 OF00053-120718-AS24	1004RL, BS1361, 1971, 415V AC, ASTA (20) CERT, made in the UK	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
MEM		 P033786.002-AS012	GEC - HRC Fuse Link - Class Q1, BS 88-2: 1975, ASTA certified, 80kA 550V A.C, 40kA 250V D. C. - 550V - Australia - no date	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
NHP	**100**	 OF00053-120718-AS27	NOS100, BS88:1:1988, 415V a.c. 80kA, 100A gG, ASTA (20) CERT, made in UK	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Nilcrom	**45**	 754-SYDEN202874-AS13	Nilcrom 60SF - 45A 250V	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**45**	 754-SYDEN202874-AS20	Nilcrom 605F 45A 250V	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**45**	 754-SYDEN202874-AS14	Nilcrom 605F 45A 250V	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Nilcrom	**45**	 OF00053-120718-AS20	SK45/C, 45A, 250V, A.C.2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**45**	 OF00053-120718-AS22	SK45C1, 45A, 250V, AC2	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**45**	 754-SYDEN202874-AS04	Nilcrom 60SF - 45A 250V	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Nilcrom	**60**	 OF00053-120718-AS17	VK60, B.S.1361, 60A, 440V AC5, F.F. “R”	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**60**	 OF00053-120718-AS08	BK-60, 60A, 250V, Rewireable Fuse, ACI F.F. “R”	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**60**	 OF00053-120718-AS23	RK60, 60A, 250V, illegible	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Nilcrom	**60**	 P033768.003-AS014	CAT.No.VK60, B.S1361, 60A, 440V-AC6, F.??.R??	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**65**	 OF00053-120718-AS16	UK65, BS1361, 65A, 440V-AC, F.F. “R”	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilcrom	**70**	 168273-66	VK70, 70A, AC5, F.F., 'R', B.S.1361	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Nilcrom	**80**	 OF00053-120718-AS11	YK80, B.S. 1361, 80A, 440V-AC5, F.F. “R”	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilsen	**8**	 168273-111	N8, 8A, AC 5, B.S.88	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Nilsen	**10**	 168273-112	NA 10, 10A, AC 5, B.S.88	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Nilsen	**20**	 174783-001-AS048	NA20, 20A, Patents Aust 161149 Brit 132428, AC5, BS 88 1952	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
No Brand	**63**	 54287-001-012	63A 63SP	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
No Brand	**63**	 55738-001-007	No Identifying marks	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
No Brand	**80**	 54287-001-009	80A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
No Brand	**400**	 54287-001-127	L17ITN	✖ Asbestos found	**In-Service Fuses:** If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
PDL	**10**	 54287-001-039	10A n20c10	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
PDL	**100**	 OF00053-120718-AS07	NYK100, certified, BS1361, 415VAC, made in UK, 100 AMP	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Reyrolle	**30**	 174783-001-AS045	MD, 30A, AC5, BS 88, Asta 20	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Reyrolle	**60**	 P033768.003 - AS002	60A, markings worn	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Reyrolle	**60**	 P033768.003-AS017	GPE-20E, ORDERING REFERENCE, 60A, CATRIDGE FUSE LINK, F.F. Class "Q", ENGLAND, BS.88.1952, 440AC4 550AC4, AA0ACS 550ACS, BRIT PAT No. 556618	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Reyrolle	**60**	 754-SYDEN202874-002	Reyrolle GPE-20E 60A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Reyrolle	**100**	 754-SYDEN202874-001	Reyrolle GPF-2F 100A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Scanlan	**75**	 55738-001-001	SCC 400V, 75A, Reg. No. 36, 699	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Scanlan		 168273-65	NEC S, no other markings	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Scanlan		 174102-001-AS018	NECS, no markings	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
SCC	**400**	 54287-001-154	EBCD 400A O	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
SIBA	**40**		SIBA 300.12.93/40	✓ Current Stock Item No. 88005	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
SIBA	**63**		SIBA 300.12.93/40	✓ Current Stock Item No. 89623	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
SIBA	**400**	 54287-001-043	5003919, AC415V, 120kA, 215	No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Siemens	**32**	 2101006/AS003	TIA32 550V 32 Amp 80 kA	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**35**	 174783-001-AS041	2NW TIS35, 35A, 80kA, 250VDC20kA, BS 88.2:1975, Q1, AS2005.2:1977	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**35**	 54287-001-078	3NWES35	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**40**	 174783-001-AS042	3NW TIS40, 40A, 80kA, BS88.2:1988, AS2005.2:1977, Q1, gG	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**80**	 OF00053-120718-AS12	3NW RHLB80, Certified BS1361, 415V a.c. 80A, made in U.K.	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**100**	 54287-001-128	3NW TC100O	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**100**	 168273-110	3NW1 131, 100A, B.S.88, AC80, Class Q1	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**100**	 54287-001-067	3NW 131	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**200**		Siemens 3NW1-232/SO, DS OSDD	Current Stock Item No. 85423	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Siemens	**200**		Siemens 3NW5-746/S-O	Current Stock Item No. 85688	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Siemens	**200**		3NW1 232/ SO, 200A, HRC Fuse Link, 80kA	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

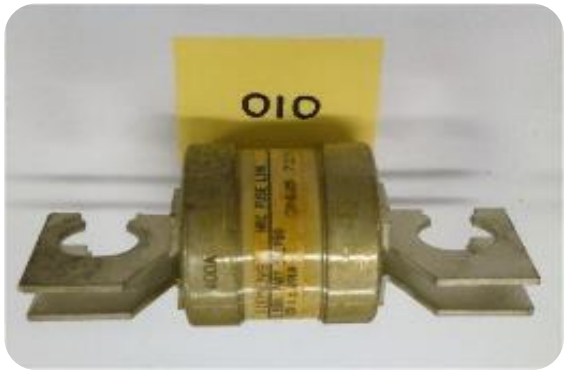
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**300**		Siemens 3NW1-241-SO,	Current Stock Item No. 85506	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Siemens	**315**	 54287-001-064	3NW 241SO 315A	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**315**	 54287-001-098	Class Q1 3NW5731SO	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**315**	 P033786.002-AS012	HRC fuse Link 3 NW t, 7 1Y O (Label torn0, 315A, Class Q1, BS88:Part 5 (Lable torn), AC80	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**400**	 54287-001-048	3NW1 251 SO 400A	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**400**	 54287-001-056	3NW1 251 SO 400A	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**400**	 54287-001-106	D 3NW5 753YO	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**400**	 55738-001-010	3NW5 733SO, HRC Fuse Link, Class Q1,	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**400**	 54093-001-007	3NW1 313/S, O, HRC fuse link, 400A	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**500**	 174102-001-AS001	3NW1 321SO, 500A, 80kA	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**500**	 P033786.002-AS012	HRC Fuse link, 3NW5 761YO, 500A, Class Q1, BS88: Part 5: 1980, A.C. 80kA	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**500**	 174102-001-AS004	3NW TTM500 OS, 500A, AC80kA, 250VDC40kA, BS 88.2:1975, Q1, AS 2005.2:1977	✕ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**600**	 54287-001-051	3NW1 351SO 600A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**630**	 54287-001-155	3NW1 351SO	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**630**	 P033786.002-AS012	HRC Fuse link, 3NW5 763SO, 630A, Class Q1, BS88: Part 5: 1980, A.C. 80kA	! No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**630**	 P033786.002-AS012	HRC Fuse link, 3NW5 763YO, 630A, Class Q1, BS88: Part 5: 1980, A.C. 80kA	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**630**	 54287-001-054	3NW1 351S 630A	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**630**	 54287-002-011	3NW1, 341S, HRC Fuse link, 415V ac, 80kA,	✗ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**800**	 54287-002-012	3NW TLT800, 550V ac-80kA, 250VDC, 40kA, gG, Q1	No Asbestos found	✓ May be used as normal. ✓ When disposing of LV HRC Fuses treat all fuses as asbestos waste.
Siemens	**800**	 174783-001-AS039	3NW1 355SO, 800A, HRC fuse link, 80kA	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**800**	 50753-001-001	3NW1 355/Z, 800A, D, HRC Fuse link Offset tags - Network Protector fuse	No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

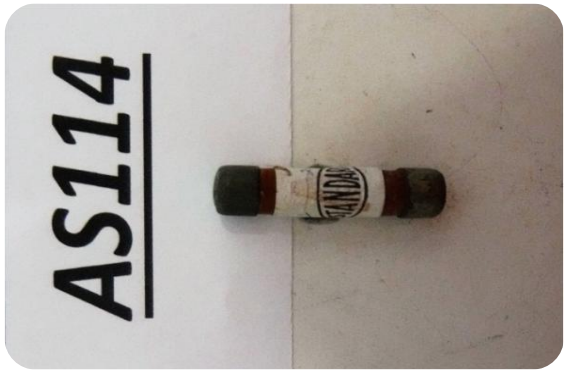
LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens	**800**	 54287-002-082	3NW1 355S HRC Fuse Link, 415V ac, 80kA,	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**800**	 50753-001-002	3NW1 355 Z, HRC Fuse link, Class Q1, Asta Cert (Pink Label) Offset tags - Network Protector fuse	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens	**800**	 54093-001-003	3NW1 355 S, Class Q1, Asti cert, 500V ac, 80kA, 250V dc, 40kA, 13.s.88.2:1995 D (Pink Label)	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Siemens		 P034242.001/C0002.AS001	HRC Fuse Link 3 NW 5, 7 63 SO - Class Q1, BS88: Part 5: 1980, AC 80 (label torn) - 415V - no country - no date - AS001	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Siemens		 754-SYDEN202874-AS15	Siemens 3NC2 425/500V ~>100kA VDE 0660	✖ Asbestos found	**In-Service Fuses:** ☐ If fuse is damaged, cease work and make safe. Contact the Hazmat Hotline - 02 9394 6961. ☐ If the fuse is intact, remove the fuse taking care not to damage in accordance with NS211 - Working with Asbestos. **Disposal:** ☐ Must be disposed of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Silized	**100**	 754-SYDEN202874-AS07 and AS08	100A 500V Silized No. 5S5 2)	⚠ No Asbestos found, exercise caution and follow safety instructions	☐ Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Standard	**2**	 168273-114	no markings, 2A	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Weber	**315**	 54287-002-067	NH2, KTF, gG, 500V ac, 100kA, EN(iE)60269, NH, 48	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Weber	**400**	 54287-002-066	NH2, KTF, gG, 500V ac, 120kA, EN(iE)60269, NH, 57	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

LV HRC Fuse Asbestos Product Guide

Manufacturer	Rating	Fuse Body Photographs	Label Markings & Details	Result	Safety Instructions
Weber	**400**	 54287-002-067	DIN 41 600, 2A, IEC127-2-1	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.
Weidmuller	**2**	 174102-001-AS032	DIN 41 600 , 2A, IEC127-2-1, 250 v, Germany	⚠ No Asbestos found, exercise caution and follow safety instructions	Where no manufacturer or date information can be confirmed and/or the fuse was manufactured prior to 2003, the **fuses should be presumed to contain asbestos and disposed** of as asbestos waste in accordance with NS211 - Working with Asbestos and SafeWork NSW Exemption 009/21.

COPY

SafeWork NSW exemption for the removal of LV HRC fuse removal by Ausgrid trained workers only

SafeWork NSW

NSW GOVERNMENT

Ref: BN-04745-2026
04/09/26

Mr Russell Margach
The Trustee for Blue Op Partnership-
Ausgrid Operator Partnership
24 Campbell Street,
Haymarket NSW 2000

Re: Exemption Order - The Trustee for Blue Op Partnership (Ausgrid Operator Partnership)

Dear Mr Margach,

We are pleased to confirm your application for exemption from compliance with sections 419(1) and 458(1) of the Work Health and Safety Regulation 2025, in relation to the removal of intact high rupturing capacity (HRC) fuses containing friable asbestos from low voltage electrical boards, has been approved.

Attached is the Exemption No. 26-031 stating the particulars of the granted exemption, including any applicable conditions.

Please note the following:

- The exemption expires on the date specified in the Exemption No. 26-031 unless cancelled or amended beforehand.
- Any conditions imposed must be complied with.
- You are entitled to seek a review of conditions imposed, should you wish to.
- At the request of SafeWork NSW, the applicant will provide details of dates and sites where Exempt Work will be undertaken under this Exemption, prior to the work commencing.
- A site visit will be undertaken within three months to verify the exemption and conditions are being adhered to in accordance with the Exemption No. 26-031.

If you have any questions regarding this exemption, please contact State Inspector, Steven Nikolovski via e-mail: steven.nikolovski@safework.nsw.gov.au or 0437 578 519.

Yours sincerely,

Janet Schorer PSM
Commissioner
SafeWork NSW

Locked Bag 2906, Lisarow NSW 2252 | 13 10 50 | safework.nsw.gov.au | ABN 90 181 234 165

1

NSW GOVERNMENT | SafeWork NSW

EXEMPTION NO. 26-031

Work Health and Safety Regulation 2025

I, Janet Schorer, SafeWork Commissioner, grant the following exemption pursuant to section 684 of the *Work Health and Safety Regulation 2025* (**Regulation**)

Dated this 4th day of September 2026

Janet Schorer
Commissioner
SafeWork NSW

1. Name of Exemption

This Exemption is the *Work Health and Safety Regulation 2025 Exemption No. 26-031*.

2. Commencement

This Exemption commences on 7 September 2026 and has effect until 6 September 2031, unless otherwise cancelled or amended.

3. Definitions

For the purposes of this Exemption

Applicant means The Trustee for Blue Op Partnership (Ausgrid Operator Partnership) ABN 78 508 211 731

Exempt Work means work to remove intact high rupturing capacity (HRC) fuses containing friable asbestos from low voltage electrical boards (including the removal and reinstallation of a fuse as part of its ordinary operation, provided the fuse remains fixed within the fuse carrier). The reinstallation of HRC Fuses can only occur where there are no reasonably practicable alternative replacements or where there is critical customers or infrastructure reliant on electrical supply

Regulation means the Work Health and Safety Regulation 2025

4. Exemption

a) This Exemption is made by SafeWork NSW pursuant to section 684 of the Regulation on the application of the Applicant.
b) The Applicant is exempt from compliance with the requirements of section 419(1) of the Regulation (prohibition on work involving asbestos or ACM) and section 458(1) of the Regulation (duty to ensure asbestos removalist is licenced) when undertaking Exempt Work.
c) This Exemption is subject to the conditions specified in Schedule 1.
d) Nothing in this Exemption affects any other applicable requirements imposed by law.

SCHEDULE 1

This Exemption is subject to the following conditions:

a) All electrical and other workplace hazards must be managed by the Applicant.
b) The Applicant must ensure that all persons undertaking Exempt Work have undertaken asbestos awareness training before undertaking Exempt Work, and work to safe work procedures while undertaking that work.
c) At the request of SafeWork NSW, the Applicant must provide details of dates and sites where Exempt Work will be undertaken under this Exemption, prior to the work commencing so that verification of safe work practices can be assessed by SafeWork NSW.
d) The Applicant must ensure that all persons undertaking Exempt Work have appropriate health monitoring.